


Herritage 'finger' way-posts

Survey for West Chiltington Parish Council June 2016 – D Weaver


Types and anatomy of Way-post

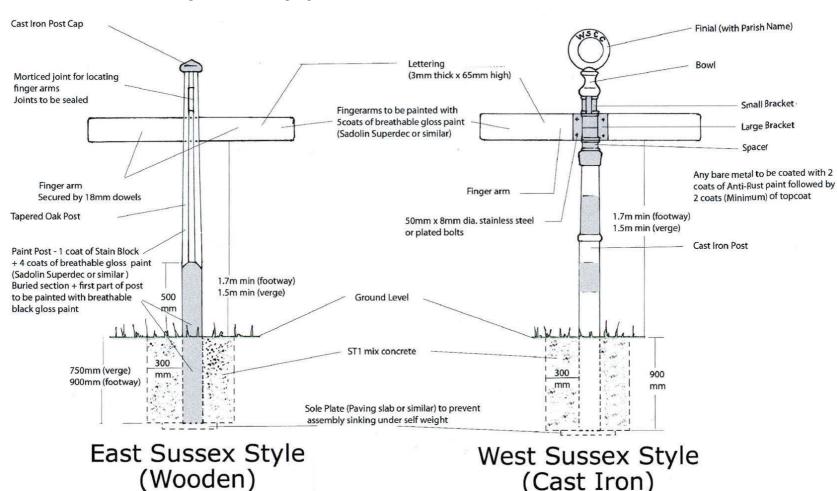

(Cast Iron)

List and location of preserved posts – 06/16

- 1 B2133, Harbolets Rd
- 2 B2133, jct to Broadford Brigde Rd
- 3 West Chiltington Village, The Hollow
- 4 Sinnocks, East Street jct to Sinnocks
- 5 Corner of Monkmead Ln and Harborough Hill
- 6 Junction of Monkmead Ln and Common Hill
- 7 Rock Cottage, Roundabout Ln
- 8 West Chiltington Common, Haglands Ln
- 9 Junction of Monkmead Ln and Nytimber
- 10 Corner of Nytimber Ln and The Common
- 11 Stream Lane, jct to Gay St
- 12 Windmill, The Hollow
- 13 Gay St, jct to Gay Street Ln

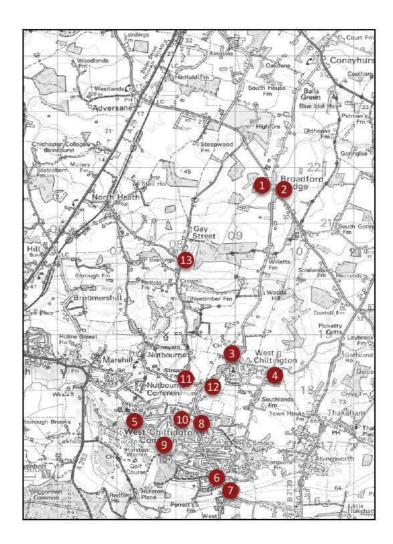



B2133 - Harbolets Rd

TYPE Prewar Cast Iron

BOARDS 4

| BOARD | TEXT | DIMENSIONS (mm) | REMARKS |
|-------|---|-----------------|-----------------|
| 1.1 | B2133 (Large) Thakeham 2 Ashington 4 | 1210 x 200 | Sound - Repaint |
| 1.2 | B2133 (Large) Adversane 1 Billingshurst 2 | 1210 x 200 | Sound - Repaint |
| 1.3 | W Chiltington 1 Storrington 4 | 900 x 200 | Sound - Repaint |
| 1.4 | Conyhurst 1 | 900 x 200 | Sound - Repaint |

IRON WORK

The iron work is in good order and seems mostly original. There are signs of moss growth and rust, the sign would therefore benefit from a clean and cosmetic repaint in the next year. The ring finial is 1930's design though when the sign was replaced after WW2 a 'THAKEHAM' finial was mistakenly fitted.

NOTES

Plastic lettering has been used to replace metal characters





B2133 – Broadford Bridge

TYPE Pole marker

BOARDS 1


| BOARD | TEXT | DIMENSIONS (mm) | REMARKS |
|-------|----------------|-----------------|-----------------------------------|
| 2.1 | W. Chiltington | 900 x 155 | Sound - 'W' missing from one side |

IRON WORK

The original iron post has been replaced with a steel pole which now shows signs of rust therefore as cosmetic clean and repaint will be required within the next 2 years. The sign has no ring finial but is capped.

NOTES

Sign is not original and is now largely redundant as larger modern signs have been placed to enhance visibility of the junction.

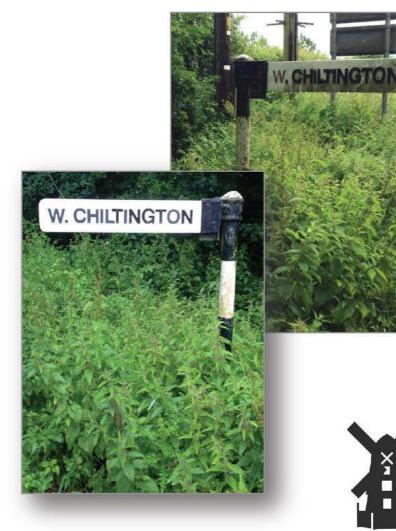

West Chiltington Village

TYPE Prewar Cast Iron (Tall)

BOARDS 3

| BOARD | TEXT | DIMENSIONS (mm) | REMARKS |
|-------|-----------------------------------|-----------------|---------|
| 3.1 | Pulborough 4 Storrington 3 | 900 x 200 | Good |
| 3.2 | Coolham Thakeham 2 | 900 x 290 | Good |
| 3.3 | Billingshurst Broadford Bridge | 900 x 290 | Good |

IRON WORK

This sign has already received major preservation work in recent years, There are minor signs of rust on the pole but this is purely cosmetic. The sign has been fitted with a newly cast finial with the county coat of arms cast and hand painted in the centre.

NOTES

The sign boards are of the 'Coastal' style with inverted fillets on each corner, this was most likely done in error during previous restoration work. The sign is obscured but overgrowth from Palmers Lodge





Sinnocks

TYPE Prewar Cast Iron

BOARDS 3

| BOARD | TEXT | DIMENSIONS (mm) | REMARKS |
|-------|--|-----------------|-----------------|
| 4.1 | West Chiltington 1 Nutborne 2 Pulborough 3 | 900 x 300 | Sound - Repaint |
| 4.2 | Smock Alley 1 Roundabout 2 Storrington 3 | 900 x 300 | Sound - Repaint |
| 4.3 | Thakeham 2 Coolham 4 Horsham 10 | 900 x 300 | Sound - Repaint |

IRON WORK

The iron work is in good condition but would benefit from a cosmetic clean and repaint within the next year. The ring finial and bowl were unscrewed and are missing - records show 1930's 'WEST CHILTINGTON' finial was previously fitted.

NOTES

Plastic lettering has been used to replace metal characters some of which are broken.





Monkmead / Harborough Hill

TYPE Prewar Cast Iron

BOARDS 3

| BOARD | TEXT | DIMENSIONS (mm) | REMARKS |
|-------|---|-----------------|-------------------------|
| 5.1 | Washington 5 Storrington 2 Roundabout 1 | 900 x 300 | Sound - Repaint |
| 5.2 | Smock Alley West Chiltington | 1000 x 200 | Rotten - Repair/Replace |
| 5.3 | Petworth Pulborough | 770 x 190 | Sound - Repaint |

IRON WORK

The iron work is in good order and seems mostly original. There are minor signs of rust, the sign would therefore benefit from a clean and cosmetic repaint in the next year. The ring finial is 1950's 'W CHILTINGTON' type.

NOTES

This sign has been well maintained the rot of the 'Smock Alley' board is the most obvious need of attention



Monkmead / Common Hill

TYPE Prewar Cast Iron

BOARDS 2


| BOARD | TEXT | DIMENSIONS (mm) | REMARKS | |
|-------|----------------|-----------------|-------------------------|--|
| 6.1 | W. Chiltington | 200 x 900 | Rotten - Repair/Replace | |
| 6.2 | Pulborough | 200 x 900 | Sound - Repaint | |

IRON WORK

The iron work is in good condition but would benefit from a cosmetic clean and repaint within the next year. The ring finial has been broken off and is missing. The bowl remains.

NOTES

The precarious location makes maintenance here more difficult than most.

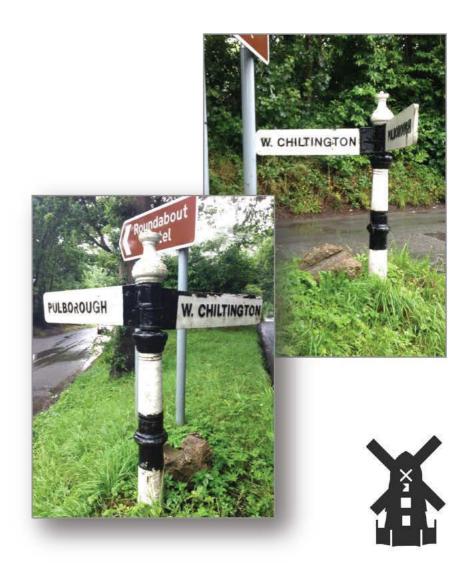

Rock Cottage

TYPE Prewar Cast Iron

BOARDS 3

| BOARD | TEXT | DIMENSIONS (mm) | REMARKS |
|-------|----------------------------------|-----------------|-----------------|
| 7.1 | W. Chiltington 1 Pulborough 3 | 900 x 200 | Sound - Repaint |
| 7.2 | Smock Alley | 900 x 200 | Sound - Repaint |
| 7.3 | Storrington 1 Worthing 11 | 900 x 200 | Sound - Repaint |

IRON WORK

The iron work is in good order and seems mostly original. There are a lot of evidence of rust but this can be rectified with a clean and cosmetic repaint providing it is addressed within the next year. The ring finial is the original 'ROUNDABOUT' design.

NOTES

This sign is one of the most prominent and most admired. It is seen by everyone entering the village from the south.



West Chiltington Common

TYPE Prewar Cast Iron

BOARDS 4

| BOARD | D TEXT DIMENSIONS (mm) | | REMARKS |
|-------|--|-----------|------------------------|
| 8.1 | The Village 1 Coolham 5 Horsham 12 | 900 x 300 | Split - Repair/Replace |
| 8.2 | Smock Alley | 900 x 190 | Sound - Repaint |
| 8.3 | Pulborough 3 Petworth 9 | 900 x 190 | Sound - Repaint |
| 8.4 | Storrington 3 Worthing 12 | 900 x 190 | Split - Repair/Replace |

IRON WORK

Close inspection shows multiple signs of damage and subsequent repair. The the current bowl is concrete and the structural integrity is provided from a scaffold pole inserted to the centre of the post. Brackets no longer move independently. Rust patches require curing and repainting. Cosmetic Repainting needed. The ring finial is post 1950's design 'W CHILTINGTON'

NOTES

Plastic lettering has been used to replace metal characters on the sign boards this has broken in places.



Monkmead / Nytimber

Prewar Cast Iron

TYPE (Missing)

BOARDS 3

| BOARD | TEXT | DIMENSIONS (mm) | REMARKS |
|-------|-------------------------------|-----------------|---------|
| 9.1 | W Chiltington 1 Horsham 12 | 900 x 300 | Missing |
| 9.2 | Storrington 2 | 900 x 190 | Missing |
| 9.3 | Petworth 9 Pulborough 3 | 900 x 190 | Missing |

IRON WORK

| Missing | |
|---------|--|
|---------|--|

NOTES

| None | | | | |
|------|--|--|--|--|
|------|--|--|--|--|



Location of previous sign (looking south from Nytimber)



Nytimber / The Common

TYPE Prewar Cast Iron

BOARDS 3

| BOARD | TEXT | DIMENSIONS (mm) | REMARKS |
|-------|----------------------------|-----------------|-------------------------|
| 10.1 | Coolham 5 Horsham 12 | 900 x 300 | Sound - Repaint |
| 10.2 | Smock Alley | 900 x 190 | Rotten - Repair/Replace |
| 10.3 | Pulborough 3 Petworth 9 | 900 x 190 | Rotten - Repair/Replace |

IRON WORK

Good original condition thouth some maintenance is needed to ensure the sign remains preserved. There is evidence of rust and some 16 coats of paint much of which needs to be blasted back before further repainting is attempted. Suggest removal of boards and errectsoda blast in situ. The ring Finial is 1930's design 'WEST CHILTINGTON'

NOTES

Sign is well preserved and all the ironwork seems original and correct. Attention is required to preserve the sign, especially with regard to repainting of the iron work. Lead is undoubtedly present in the lower coats of pain hence caution needs to be taken. May be possible to soda blast in situ. Immediate action is needed in order to preserve this sign.



Stream Lane / Gay Street

TYPE Pole Marker

BOARDS 3

| BOARD | TEXT | DIMENSIONS (mm) | REMARKS | 1 |
|-------|-------------------------------|-----------------|---------|---|
| 11.1 | Gay Street | 900 x 200 | Missing | |
| 11.2 | Nutborne 1 Pulborough 2 | 900 x 200 | Missing | |
| 11.3 | W. Chiltington 1 Coolham 4 | 900 x 200 | Missing | |

IRON WORK

The original iron post has been replaced with a steel pole. The sign has been fitted with a modern aluminium cast finial with the county coat of arms printed on (this has now worn away)

NOTES

Location of sign has overgrown considerably. All boards have broken off. Construction of sign not really intended for rural use. Needs replacement.





Windmill

TYPE Oak Post (East Sussex)

BOARDS 3

| BOARD | TEXT | DIMENSIONS (mm) | REMARKS |
|-------|----------------|-----------------|-----------------|
| 12.1 | W. Chiltington | 700 x 180 | Sound - Repaint |
| 12.2 | Nutborne | 650 x 150 | Sound - Repaint |
| 12.3 | Storrington | 700 x 180 | Sound - Repaint |

IRON WORK

None - Post is oak and is mostly sound however there are signs of rot at the base. The extent that the post is able to move indicates this rot may already be quite advanced. The mortice joints seem very sold and well sealed, though ivy growth has started to effect the join to the 'Nutborne' board. The cast iron top cap is missing.

NOTES

The sign is greatly obscured by overhanging foliage (as evident in the pictures). Attention is required to reinforce the rotten base.



Gay Street

Prewar Cast Iron

TYPE (Missing)

BOARDS 3

| BOARD | TEXT | DIMENSIONS (mm) | REMARKS |
|-------|-------------------------------|-----------------|---------|
| 13.1 | W Chiltington 2 Gay Street | 900 x 200 | Missing |
| 13.2 | Adversane 2 North Heath | 900 x 200 | Missing |
| 13.3 | No Through Road | 900 x 200 | Missing |

IRON WORK

Missing

NOTES

None



Location of previous sign (Looking East for Gay Street Ln)



Preservation Status Summary

- 1 **B2133**, Harbolets Rd
- 2 B2133, jct to Broadford Brigde Rd
- 3 West Chiltington Village, The Hollow
- 4 Sinnocks, East Street jct to Sinnocks
- 5 Corner of Monkmead Ln and Harborough Hill
- 6 Junction of Monkmead Ln and Common Hill
- 7 Rock Cottage, Roundabout Ln
- 8 West Chiltington Common, Haglands Ln
- 9 Junction of Monkmead Ln and Nytimber
- 10 Corner of Nytimber Ln and The Common
- 11 Stream Lane, jct to Gay St
- 12 Windmill, The Hollow
- 13 Gay St, jct to Gay Street Ln



Attention Required for Repair or Preservation

Maintenance Required within 12 months

Maintenance Required within 2 years

#2, #9, #11, #13 Signs are missing or are no longer 'original'.



Finger Sign Preservation

WSCC Southern Area Office

Clapham Common,

Clapham,

Worthing

BN13 3UR

Highways.southern@westsussex.gov.uk

Or call - 01243 642105

Heritage Finger Sign Posts

Greens Farm Road

Newdigate

Surrey

07552 932419

fingerpostsigns.com

heritagefingerpostsigns@vmail.com

Ralphs Restorations

Ashington

01903 892418

Images taken from fingerpostsigns.com



